


Circuit Protection Terminals

Warning:

- Install AP partition after last ASK 1 or KDKS 1.
- Disconnect power before replacing the fuse.

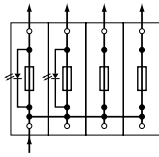

Fuse terminals are available with LED blown fuse indicators, which speed identification of fuse failures and reduces costly down time. The maximum operating voltage for the indicator fuse blocks is determined by the LED's rating.

A 2 mA residual current passes through the LED when the fuse is blown, unless otherwise indicated.

WTR 2.5/SI


with fuse holder
for G fuse cartridges 5x20



**Pluggable Fuse,
Single Level
5 x 20 mm fuse**

WTR 4 SI

with fuse holder
for G fuse cartridges 5x20

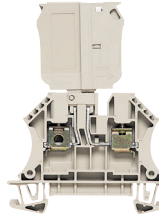

**Pluggable Fuse,
Single Level
5 x 20 mm fuse**

Terminal Block Selection Data

Available Options	Version	Part No.	Part No.
	Beige Wemid	1763940000	7910240000
10 VDC-36 VAC Beige Wemid/LED		1763950000	7914370000
35 VDC-70 VAC Beige Wemid/LED		1763960000	7914380000
60 VDC-150 VAC Beige Wemid/LED		1763970000	7914390000
140 VDC-250 VAC Beige Wemid/LED		1763980000	7914400000

Dimensions

Width / Length / Height mm (in.)	for TS 35	5/60/83 (.20/2.36/3.27)	6/60/82 (.24/2.36/3.23)
Insulation stripping length	mm (in.)	10 (.39)	13 (.51)

Technical Data

Rated voltage / rated current / wire size	UL	300 V / 10 A / #22...12 AWG	300 V / 6.3 A / #22...10 AWG
	CSA	300 V / 6.3 A / #22...10 AWG	300 V / 6.3 A / #22...10 AWG
	VDE	400 V / 6.3 A / 2.5 mm ²	400 V / 6.3 A / 2.5 mm ²
Torque	Nm (lb. in.)	0.4...0.8 (3.5...7.0)	
Clamping screw	M	2.5	3

Selected Accessory Data*

End Plate (AP) (thickness mm)	Type	Part No.	Type	Part No.
Beige Wemid	WAP (2.5-10)	1050000000	WAP (1.5)	1050000000
Blue Wemid	WAP (2.5-10 BL)	1050080000	WAP (1.5)	1050080000
Beige Wemid	WTW (2.5-10)	1050100000	WTW (3)	1050100000
Blue Wemid				

Jumpers

2 pole	QL 2	0215800000	ZQV 4N/2	1758250000
3 pole	QL 3	0215900000	ZQV 4N/3	1762630000
4 pole	QL 4	0216000000	ZQV 4N/4	1762620000
10 pole	QL10	0338000000	ZQV 4N/10	1758260000
24 pole	WQB 24/16	1579060000		
41 pole			ZQV 4N/41	1758270000
Blank			QB 75/6-2/15	0535200000
Black			ISPF QB75 SW	0526700000
Blue			ISPF QB75 BL	0526780000
Red			ISPF QB75 RT	0526760000
Jumper screw	BS M 3x5	1052100000		

Test Plug/Socket

Test plug		PS 2.3	0180400000
Test adapter		WTA 6	1632380000

G Fuse Cartridges, 5 x 20 mm

Rated current (A):	0.10 rapid-blow	0430300000	0430300000
Rated voltage 250 VAC	0.20 rapid-blow	0430400000	0430400000
Note: For listing of	0.25 rapid-blow	0430500000	0430500000
5 x 25 mm fuses see page 28.	0.50 rapid-blow	0430600000	0430600000
	1.0 rapid-blow	0430700000	0430700000
	1.6 rapid-blow	0430800000	0430800000
	2.0 rapid-blow	0430900000	0430900000
	2.5 rapid-blow	0431000000	0431000000
	3.15 rapid-blow	0431100000	0431100000
	4.0 rapid-blow	0431200000	0431200000
	5.0 rapid-blow	0431300000	0431300000
	6.3 rapid-blow	0431400000	0431400000

Tools

Notching tool for QL jumper hole	WAW 2	0900450000	
----------------------------------	-------	------------	--

Marking Tags

Print	Print
Consecutive horizontal	DEK 5/5 0473460001 DEK 6 0468660000
Consecutive vertical	DEK 5/5 0473560001 DEK 6 0468760000
Blank	WS 12/6 1609900000
Printed	WS 12/6 1447660000

Note: Part numbers shown are for a single card of pre-printed tags numbered 1-50. For additional information, see Accessories section.